

# Machine Service Bulletin No. 430


MODEL: LA-5 and LA-6

DATE:

6-10-46

SUBJECT: Automatic Division Shift Cam Movement

A 56071 spacing washer (B) is being installed in current LA-5 and LA-6 machines between the 40-707 shift cam (D) and the 4180 spring (C) to eliminate the possibility of (D) moving too far in the direction of arrow (E) when the division lever (A) and 4705 slide (X) are automatically restored to neutral position.

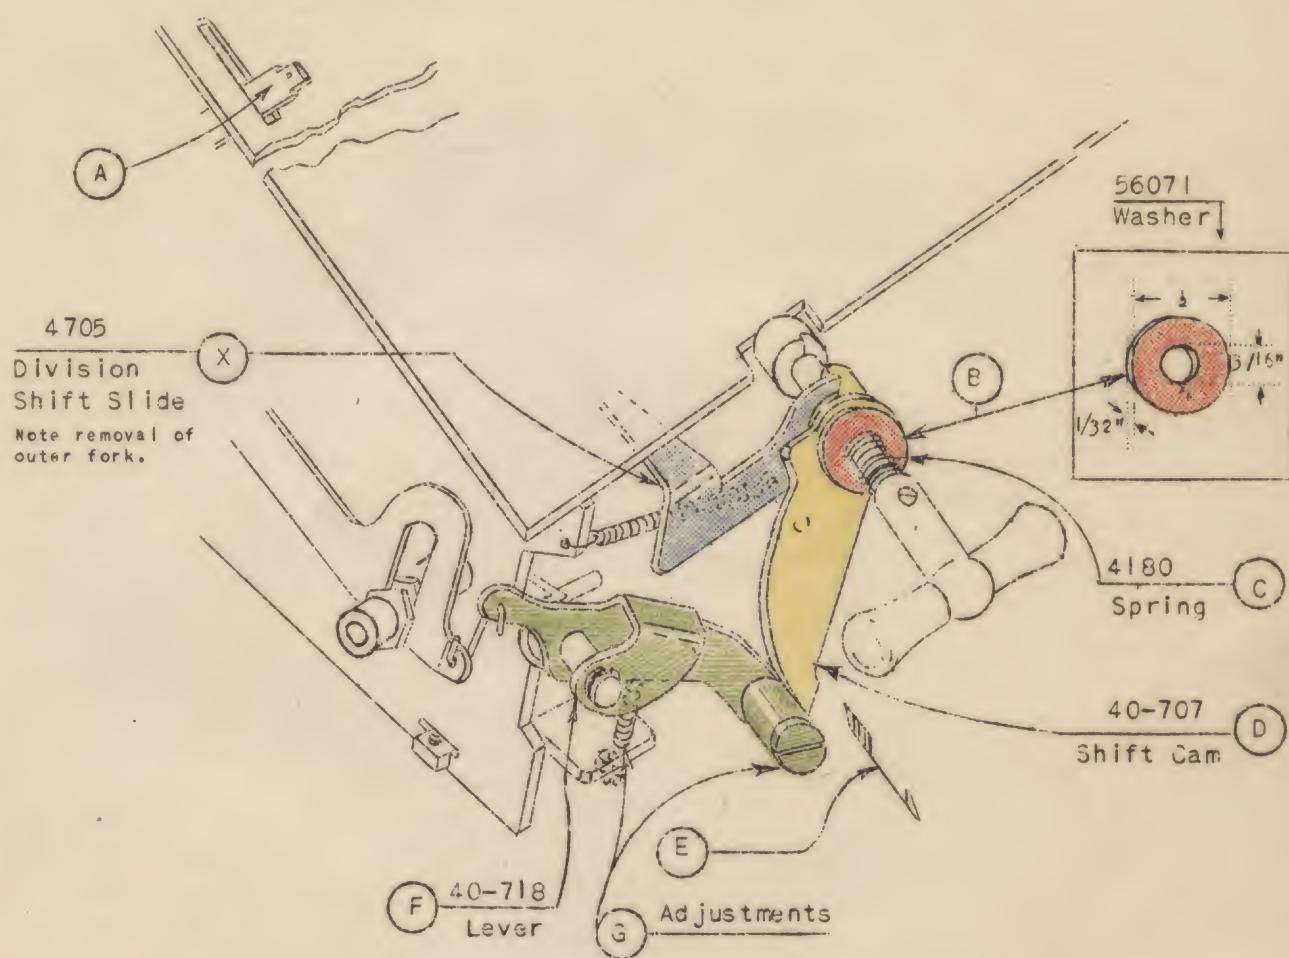

It is important that the 40-718 lever (F) and 40-707 shift cam (D) are properly adjusted at (G) and aligned in relation to each other.

PRINTED IN U.S.A.

MONROE CALCULATING MACHINE COMPANY, INC.

General Service Department, Orange, New Jersey, U. S. A.